

BLEND AREA REFINISHING

OPTION 1:

- **Step 1** Clean blend areas with R7K158 or SC155 Surface Cleaner.
- **Step 2** Scuff sand using a gray nylon scuff pad along with USP90 Liquid Scuffing Gel.
- **Step 3** Thoroughly rinse off the scuffing agent with clean water and completely dry the surface.
- **Step 4** Re-clean the surface with R7K158 or SC155 Surface Cleaner.
- Step 5 Apply 1 medium wet coat of 2K S65 Basecoat
 Transparent / Adhesion Promoter. It is highly
 recommended that the S65 is used on high metallic /
 mica containing colors.

OPTION 2:

- **Step 1** Clean blend areas with R7K158 or SC155 Surface Cleaner.
- Step 2 Sand the blend areas with P800 grit sandpaper. Thoroughly scuff unsanded areas with a gray nylon scuff pad. Then repeat above Steps 4 and 5.

